- 1. TESTS OF SECOND SYSTEM XII INDICATOR UNIT (AT-2112-411, IDF-2), S/N 5, RECENTLY RECEIVED XWCARD REVEALS CRITICAL WIRING ERROR AS FOLLOWS:
- A. ILLUMINATING SIGNAL AT ZERO DEGREE BEARING CAUSES STROBE TO GIVE 180 DEGREE BEARING, AND VICE VERSA. WE HAVE REVERSED WIRES TO TERMINALS 9 AND 10 (VERTICAL DEFLECTION PLATES OF 1EP1 DISPLAY TUBE). UNIT NOW OPERATES PROPERLY.
- B. STUDY OF PROBLEM INDICATES IEPI SOCKET INSTALLED "UPSIDE DOWN". WIRING TO TERMINALS 6 AND 7 (HORIZONTAL DEFLECTION PLATES) REVERSED AT PLANT TO COMPENSATE, BUT TERMINAL 9 AND 10 OVERLOOKED. UNABLE PROVE THIS UNTIL WE PULL UNIT S/N 3 FROM ARTICLE.
- 2. WIRES IN QUESTION ALL WHITE WITH NO COLOR CODING. RECOMMEND ALL USERS CHECK SOONEST TO DETERMINE WHETHER SIMILAR CONDITION EXISTS.

 END OF MESSAGE

